

Date: Thursday, 23/04/2009 1:35:03 PM
 User: Julie Dawson

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 350 SKIDTUBE ASSEMBLY LH
 Job Number : 47397 ✓
 Estimate Number : 10262
 P.O. Number :
 This Issue : 23/04/2009 S.O. No. :
 Prsht Rev. : NC Part Number : D350636011 ✓
 First Issue : // Type : SKIDTUBES Drawing Number : D2750 REV F
 Previous Run : 47037 Drawing Revision : F
 Material :
 Due Date : 08/05/2009 Qty: 1 Um: Each
 Written By :
 Checked & Approved By : JLD 09.04.23
 Comment : Est Rev:J 02.09.25 Rearranged procedure steps KJ
 Est Rev:J 06-03-23 As per Rev D JLM
 Est Rev:K 06-07.13 As per dsi9343 EC
 Est Rev:L 07-07-28 Added SS Wearplates(Rev E) JLM
 Verified By:EC
 Est Rev:M 08-04-22 update steps 4, 13 DD verified by:EC
 Est Rev:N 08-09-23 revF as per dwg DD verified by:ec
 Est Rev:O 09-02-06 apply antiseize on AN8C21A bolts as per
 PAR09-010 DD verified by:EC

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



for JLD 09/05/08



Comment: DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-011 CHG 004

2.0 D26003BENT Extrusion Bent



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2600-3-Bent

Extrusion (Bent)

G47133

D H 9-4-27

3.0 D2744 Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch:

B 44092 BE 09/04/27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/04/2009 1:35:03 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 47397

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

4.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

- 1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end
- 2-Drill pilot holes as per Dwg D2750 sheet 4 (D2750-1 details).Drill using drill Jig DT8150 & DT8863.
- 3- Mark fwd end for cutting using Drill Jig DT 8150 & DT8863 and cut as per dwg D2750.
- 4- drill pilot holes for blade fitting bolt holes using DT8983. Open to 0.500"
- 5- locate DT8330 off of blade fitting bolt holes and drill pilot holes for blade fitting
- 6-Open up holes for Detail B to 0.375" (4 holes per side)and blade fitting location holes to 0.500" (total of 4 holes per side) as per dwg D2750 .Open up holes for ground handling and detail C to 0.500" (8 holes per side)
- 7-Drill pilot holes for wearplates as per Dwg D2750 using DT8108 open to 0.297".
- 8-Open up holes of Detail A to 0.297" (total of 2 holes per side)
- 9-Weld D2744 Cap as per Dwg D2750 and QSI 004.Fill grooves in bend left from bending as per QSI 004
A/R Aluminum Rod *m110972 BE 09/04/27*
- 10-Grind welds flush as per Dwg D2750 *fm 09-04-27*
- 12- Scribe batch# inside per dwg D2750 *u 9-4-27*

5.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/04/2009 1:35:03 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 47397

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

D 119-4-28

9.0

D2739

350 I Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Web

Batch: B47409

Pm '09-04-28 (13)

10.0

D34901

Cross Bolt Spacer



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Crossbolt spacer

Batch: B47118

Pm '09-04-30

11.0

D34903

Cross Bolt Spacer



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Crossbolt spacer

Batch: B45560

Pm '09-04-30

12.0

D2743

Crossbolt Spacer



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

Crossbolt Spacer

Batch: B45555

Pm '09-04-30

13.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open up holes of Detail C and ground handling to 0.625" (total of 8 holes per side)
as per dwg D2750.

2-Open up holes of Detail B to 0.750" (total of 4 holes per side)
as per dwg D2750.

3- Open float hole to 0.500" (4 per side)

4-Chamfer holes of Detail B, C, ground handling and float holes per dwg D2750 (welding instructions on
sheet 8)

Pm '09-04-28 (13)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/04/2009 1:35:03 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 47397

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

5-Deburr and blow out all chips from inside of tube

6- Prepare tube for welding, remove alodine as required.

7-Bond web D2739 in place as per QSI 015

A/R Sikaflex-291 batch: M111081
exp. date: 10-01-20

8- Weld spacers D3490-1, D3490-3 and D2743 as per dwg D2750 & QSI004
(welding instructions on sheet 8)

A/R Aluminum Rod batch: M110972 BE 09/04/30

9-Grind welds flush as per Dwg D2750

10-Spot face ground handling holes section (total of 4 places per side) as per dwg D2750

11-Deburr holes

fm 09-04-28 (1)

11-4-30

14.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

S 08/05/04 (1)

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/05/04 (1)

16.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

UND/ FL 09/05/05 (1)

17.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat Gloss White (Ref. 4.3.5.1) as per Dart QSI 005 4.3

START TIME:

1:35

OVEN TEMPERATURE:

320°

FINISH TIME:

2:05

FL 09/05/05 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/04/2009 1:35:03 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 47397

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect for foreign object per QSI 024

BR 09-05-7 ①

19.0

ALS41032225

Insert



Comment: Qty.: 38.0000 Each(s)/Unit Total : 38.0000 Each(s)

Insert

Batch: M110768

BR

20.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1- Install inserts as per Dwg D2750

BR 09-05-7 ①

21.0

D2745

Bushing



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Bushing

Batch: BL5586

BR

22.0

D37911

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: B47210

BR

23.0

D37931

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearshoe

Batch: B47024

BR

24.0

D37933

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearshoe

Batch: B47211

BR

BR 09-05-7 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/04/2009 1:35:03 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 47397

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

25.0

D37941

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Gasket

Batch: B47212

BR

26.0

D37943

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Gasket

Batch: B47446

BR

27.0

D353525

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B45715

BR

28.0

D353625

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: 47611

BR

29.0

D35371

Wearpad



Comment: Qty.: 3.0000 Each(s)/Unit Total : 3.0000 Each(s)

WEARPAD

Batch: B46886

BR

30.0

D36311

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

WASHER

Batch: B45353

BR

31.0

D3488041

Blade Fitting Assembly, LH



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Blade Fitting, LH

Batch: B41853

BR

09-05-70
Form: rprocess

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/04/2009 1:35:04 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 47397

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

32.0

AN3C5A

Bolt



Comment: Qty.: 34.0000 Each(s)/Unit Total : 34.0000 Each(s)

Bolt

Batch: M111424

BR

33.0

AN3C6A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M112372

BR

34.0

AN6C44A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

BOLT

Batch: M110665

BR

35.0

AN8C35A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

BOLT

Batch: M110105

BR

36.0

AN960C10L

washer



Comment: Qty.: 38.0000 Each(s)/Unit Total : 38.0000 Each(s)

washer

Batch: M110548

BR

37.0

AN960C816L

WASHER



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WASHER

Batch: M110139

BR

38.0

MS210436

NUT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

NUT

Batch: M110584

BR

BR 09-05-7

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/04/2009 1:35:04 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 47397

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

39.0

MS21083C8

NUT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

NUT

Batch: M140584

BR

40.0

NAS1515H3L

WASHER



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

WASHER

Batch: M110806

BR

41.0

D34921

Plug



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Plug

batch: B46692

BR

42.0

NAS1611010

O-RING



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

O-RING

batch: _____

BR

PTO ->

43.0

D34923

Plug



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Plug

batch: B47473

BR

44.0

NAS1611013

O-RING



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

O-RING

batch: M106513

BR

45.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Inspect for Foreign Objects

2-Spray inside of tube with "LPS-3" batch: _____

BR 09-05-7

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
09-05-7	42.0	CHANGE O'RING FOR 2594-3 BATHB29908	BK	09-05-7	8		S. / 09/05/07

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/04/2009 1:35:04 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 47397

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

3-Install blade fitting D3488-041, wearshoes and ground handling hardware as per dwg D2750

SIKA FLEX 241

BATCH: M111081

EXP DATE: 10-20

4-assemble o'ring to plug as per dwg D3492 and apply o'ring lube

A/R 55-o'ring lube batch M101323

5-Coat all exposed fasteners with "LPS Procyon"

batch

M104251 PR 09-05-7 ①

46.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

20/05/07 (K)

47.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

48.0

D2741

Blade, 350 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Blade

Batch: B45320

9/5/8

49.0

AN8C21A

BOLT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch: M110342

*****apply antiseize prior to packaging*****

Batch: M110658

9/5/8

50.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch: M111424

9/5/8

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/04/2009 1:35:04 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 47397

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

51.0

NAS1515H8L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: M100964

9/5/8

SP

52.0

MS21083C8

NUT



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Nut

Batch: M111424

9/5/8

SP

53.0

D34931

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: B44902

9/5/8

SP

54.0

D35321

Spacer



Comment: Qty.: 2.0000 (s)/Unit Total : 2.0000 (s)

batch:

B44904

9/5/8

SP

55.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

*****ensure antiseize is on AN8C21A bolts*****

09-05-08 ①

56.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Package as per PPP D350-636-011

rev 9/5/8

SP

57.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

09/05/11

Job Completion



MF 09-05-10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

QTY -041	QTY -042	QTY -043	QTY -044	PART NUMBER	DESCRIPTION
X				D2750-041	350 SKIDTUBE ASSEMBLY, LH
	X			D2750-042	350 SKIDTUBE ASSEMBLY, RH
		X		D2750-043	350 SKIDTUBE ASSEMBLY, LH
			X	D2750-044	350 SKIDTUBE ASSEMBLY, RH
1	1	1	1	D2739	WEB
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
1	1	1	1	D3535-25	WEARSHOE
1	1	1	1	D3536-25	GASKET
3	3	3	3	D3537-1	WEARPAD
8	8	8	8	D3631-1	WASHER
1	1	1	1	D3791-1	WEARPLATE
1	1	1	1	D3793-1	WEARSHOE
1	1	1	1	D3793-3	WEARSHOE
1	1	1	1	D3794-1	GASKET
1	1	1	1	D3794-3	GASKET
38	38	38	38	ALS4-1032-225	INSERT (OR ALS7-1032-225, AKS4-1032-225, AELS-1032-225)
34	34	34	34	AN3C5A	BOLT
4	4	4	4	AN3C6A	BOLT
4	4	4	4	AN6C44A	BOLT
1	1	1	1	AN8C35A	BOLT
38	38	38	38	AN960C10L	WASHER
1	1	1	1	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
1	1	1	1	MS21083C8	NUT
4	4	4	4	NAS1515H3L	WASHER


GENERAL NOTES:

- MATERIAL: MAKE D2750-1/-2/-3/-4 FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
- FINISH:
ACID ETCH, ALONDE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.
POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
- TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED
- BREAK SHARP EDGES: N/A
- IDENTIFICATION: N/A
- WEIGHT: D2750-041/-042/-043/-044 = 26.5 LBS
- WELD PER DART QSI 004
- INSTALL ALS4-1032-225 INSERTS AFTER FINISH AS INDICATED. DRILL 'F' SIZE HOLES ($\phi 0.297$) FOR WEARSHOE INSERTS
- FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 KSI
MINIMUM ULTIMATE TENSILE STRENGTH = 38 KSI
- SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS.
COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY. CLEAN EXCESS OFF
POWDER COATING WITH MEK DEGREASER
- SPACER AND PLUG INSTALLED SAME AS SECTION AJ-AJ EXCEPT HORIZONTAL
- SPACER AND PLUG INSTALLED SAME AS SECTION AP-AP EXCEPT HORIZONTAL

RELEASED

F	INCORPORATE DSI 9413; QTY (3) D3637-1 WAS QTY (5) (ZN C8-1); D3791-1/3 REPLACES D3535-13/35 (ZN C8-1); D3794-1/3 REPLACES D3536-13/35 (ZN B8-1); ADD D3791-1 (ZN C8-1); WEARSHOE HOLES UNDER FWD/AFT SADDLE REMOVED (8 PL); WEARSHOE HARDWARE QTY UPDATED (ZN B8-1); D3488-041/-042 HARDWARE UPDATED (ZN C1-8, 9, 10, 11); ADD NOTE 12 AND 13 (ZN A6-1); REASON: REF. NCR 08-043	PH	08.07.16
E	CHANGE TO STAINLESS STEEL WEARPLATES; ADD RUBBER GASKETS; CHANGE INSERTS; ADD D3631-1; REMOVE QTY (38) NAS1515H3L; REMOVE QTY (10) NAS1515H8L; REMOVE D2741, QTY (2) AN960C816; REMOVE QTY (2) MS21083C8	CB	07.05.17
D	ADD HOLES AND SPACERS FOR APICAL FLOATS; INCORPORATE DEO 9133/9157	PH	06.01.05
C	ADD D2750-3/D2750-4; INCORPORATE D2738 AND D2740	CP	98.11.18
B	CHANGE MS24694-S293 TO AN8-16A	CP	98.09.01
A	NEW ISSUE	DS	98.04.16
REV.	DESCRIPTION	BY	DATE
DESIGN	PA	DART AEROSPACE USA, INC.	
DRAWN	PA	PORT HADLOCK, WA	
CHECKED	AP	DRAWING NO.	REV. F
MFG. APPR.	AP	D2750	SHEET 1 OF 11
APPROVED	AP	TITLE	SCALE
DE APPR.	AP	350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO 4731

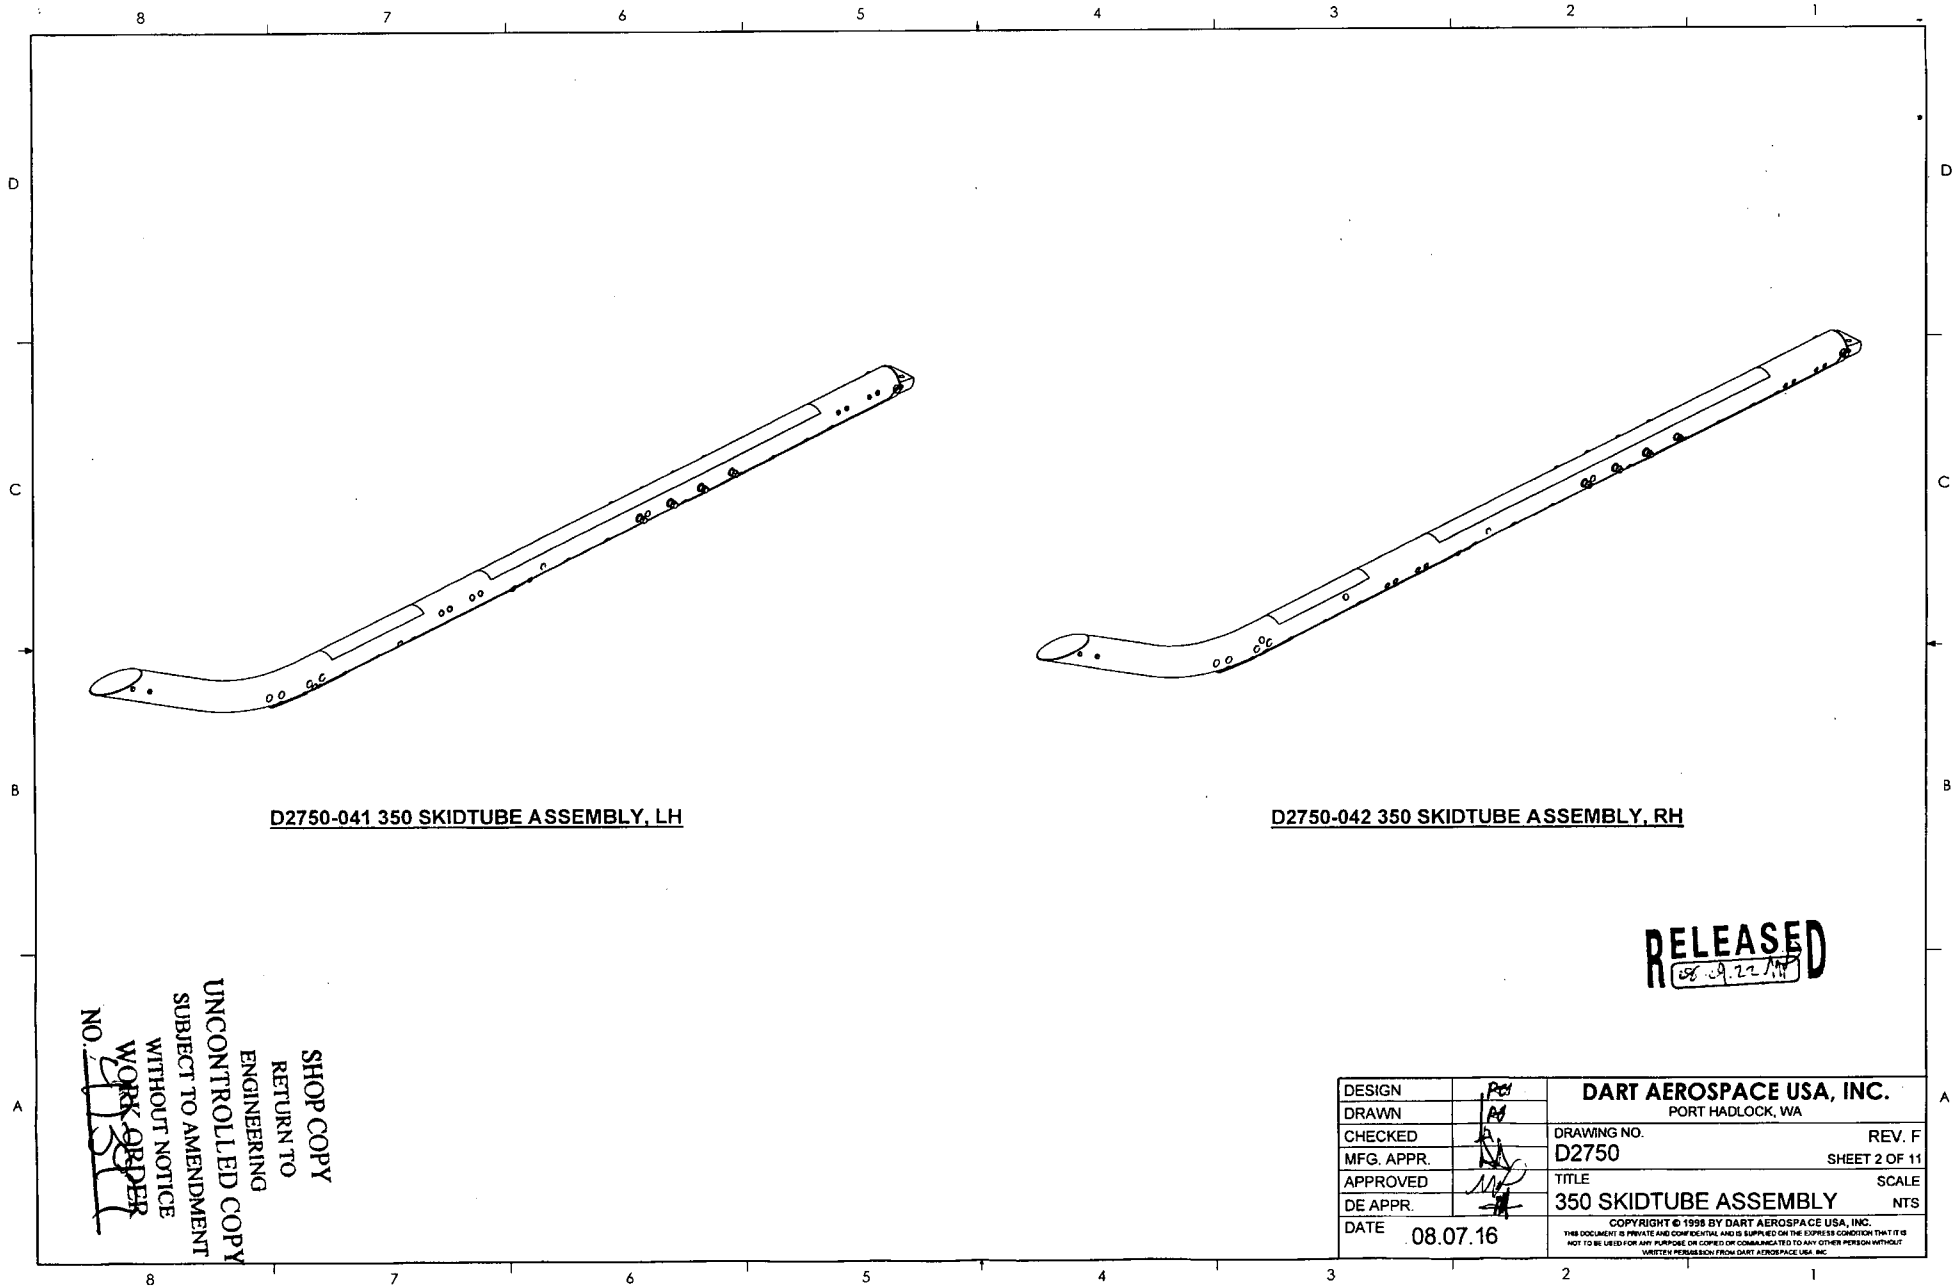


D2750-041 350 SKIDTUBE ASSEMBLY, LH


D2750-042 350 SKIDTUBE ASSEMBLY, RH

RELEASED
 28 JAN 1977


SHOP COPY
 RETURN TO
 ENGINEERING
 UNCONTROLLED COPY
 SUBJECT TO AMENDMENT
 WITHOUT NOTICE
 WORK ORDER
 NO. 2737

DESIGN	PM	DART AEROSPACE USA, INC.	
DRAWN	AM	PORT HADLOCK, WA	
CHECKED	A	DRAWING NO. D2750	REV. F
MFG. APPR.	MA	SHEET 2 OF 11	
APPROVED	MP	TITLE	SCALE
DE APPR.	MA	350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

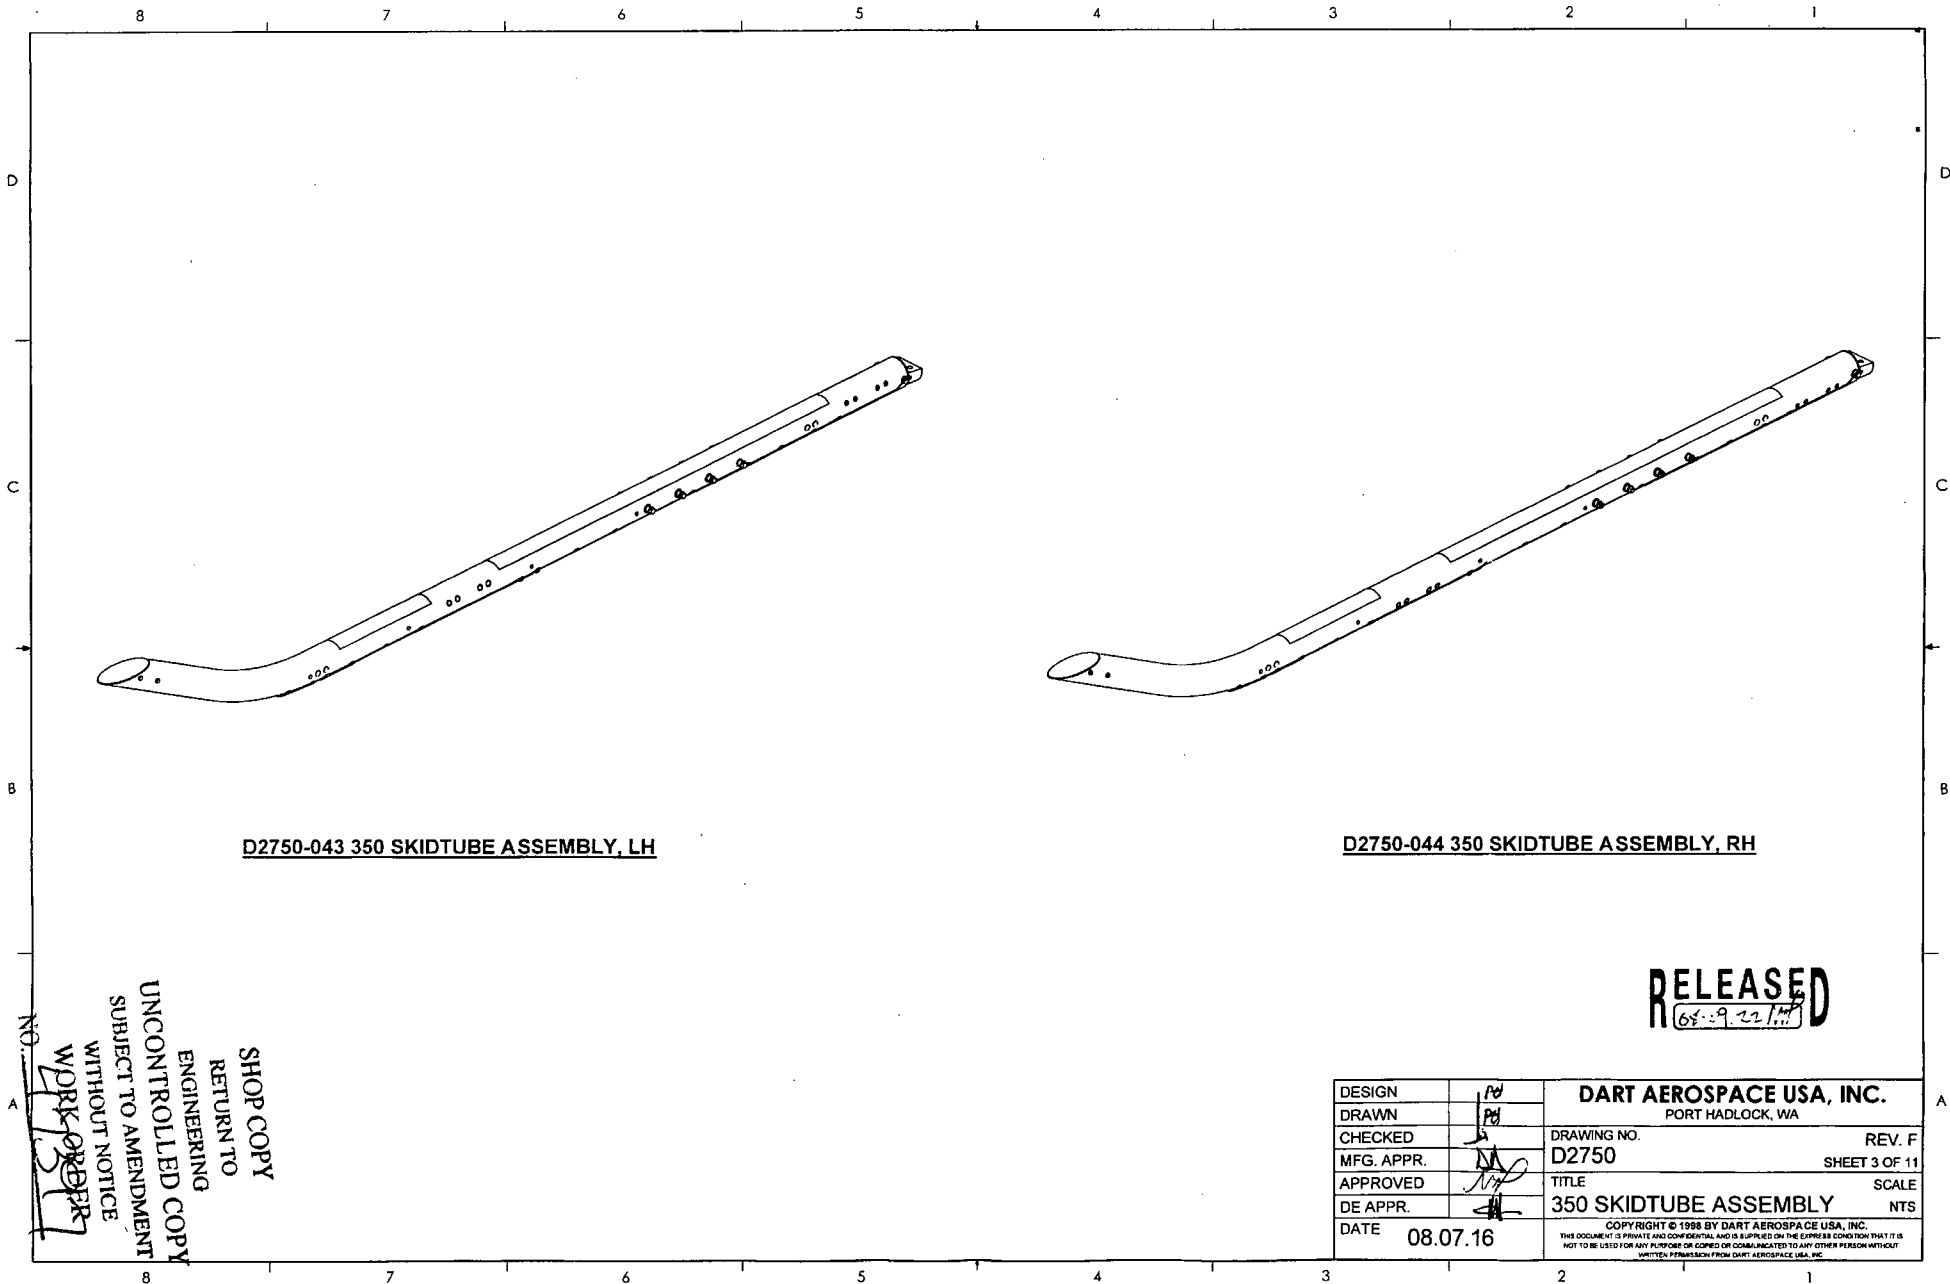


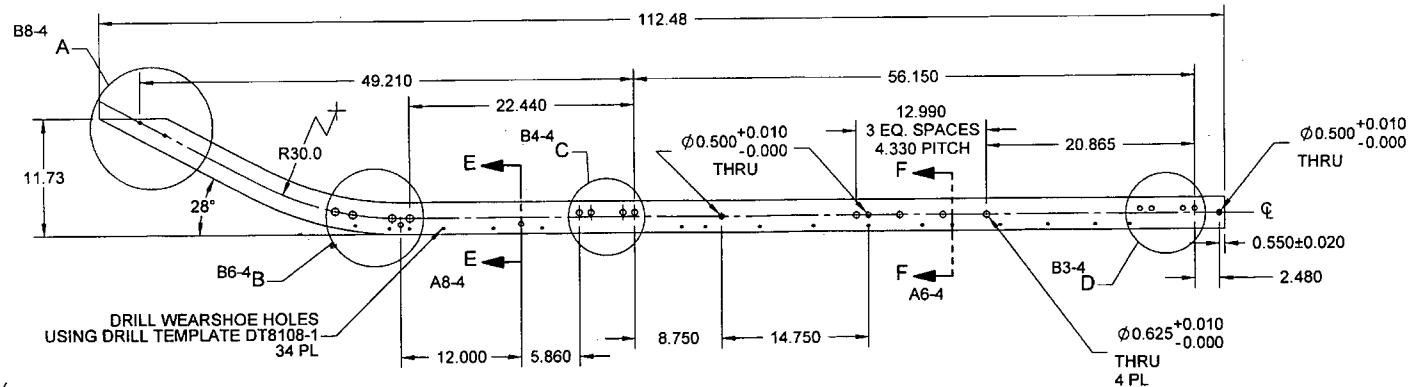


D2750-1 LH SKIDTUBE

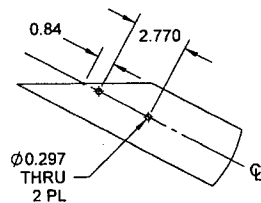


DETAIL A
SCALE 2X

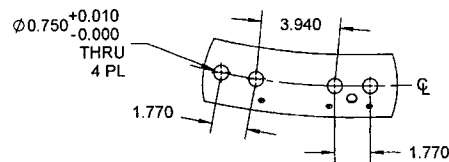


DETAIL B
SCALE 2X

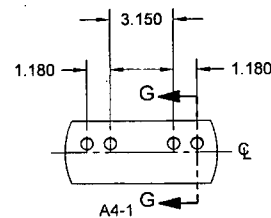


DETAIL C
SCALE 2X

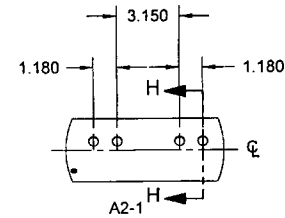


DETAIL D
SCALE 2X

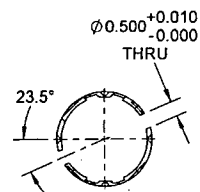


SECTION E-E
SCALE 3X, 2 PL

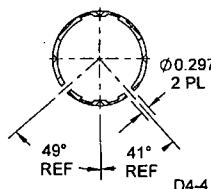

SECTION F-F
SCALE 3X, 17 PL

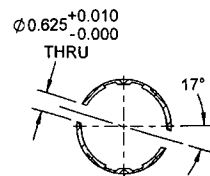

SECTION G-G
SCALE 3X, 4 PL

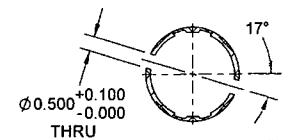


SECTION H-H
SCALE 3X, 4 PL


RELEASED

DESIGN	PM	DART AEROSPACE USA, INC.	
DRAWN	PM	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2750	SHEET 4 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	<small>COPYRIGHT © 1988 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
NO WORK ORDER
12/25/16

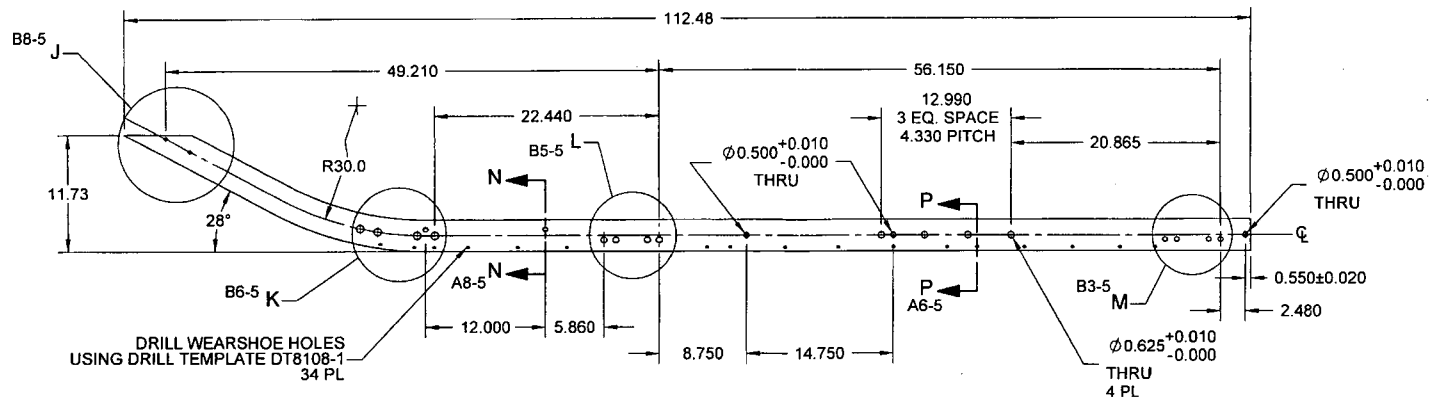


D2750-2 RH SKIDTUBE

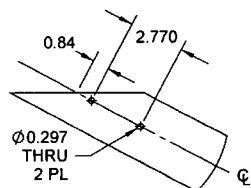


DETAIL J
D8-5
SCALE 2X

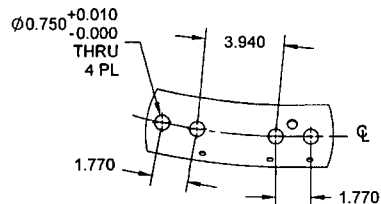


DETAIL K
C7-5
SCALE 2X

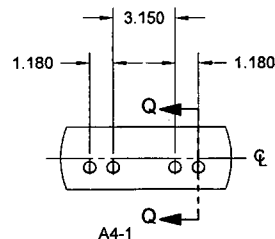


DETAIL L
D6-5
SCALE 2X

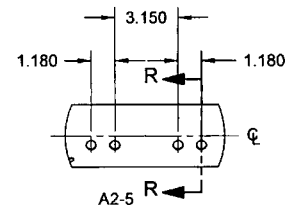


DETAIL M
C3-5
SCALE 2X

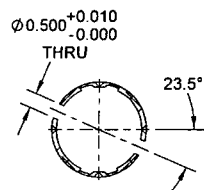


SECTION N-N
C6-5
SCALE 3X, 2 PL

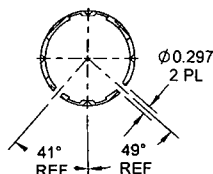

SECTION P-P
C4-5
SCALE 3X, 17 PL

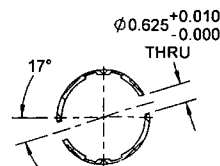

SECTION Q-Q
B5-5
SCALE 3X, 4 PL

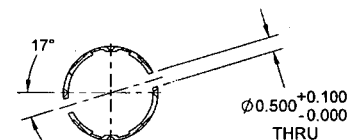

SECTION R-R
B3-5
SCALE 3X, 4 PL

RELEASED

DESIGN	PC	DART AEROSPACE USA, INC.	
DRAWN	PC	PORT HADLOCK, WA	
CHECKED		DRAWING NO. D2750	REV. F
MFG. APPR.			SHEET 5 OF 11
APPROVED		TITLE 350 SKIDTUBE ASSEMBLY	SCALE
DE APPR.			NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

NO
WITHOUT NOTICE
AMENDMENT
CONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

8

7

6








5

4

3

2

1

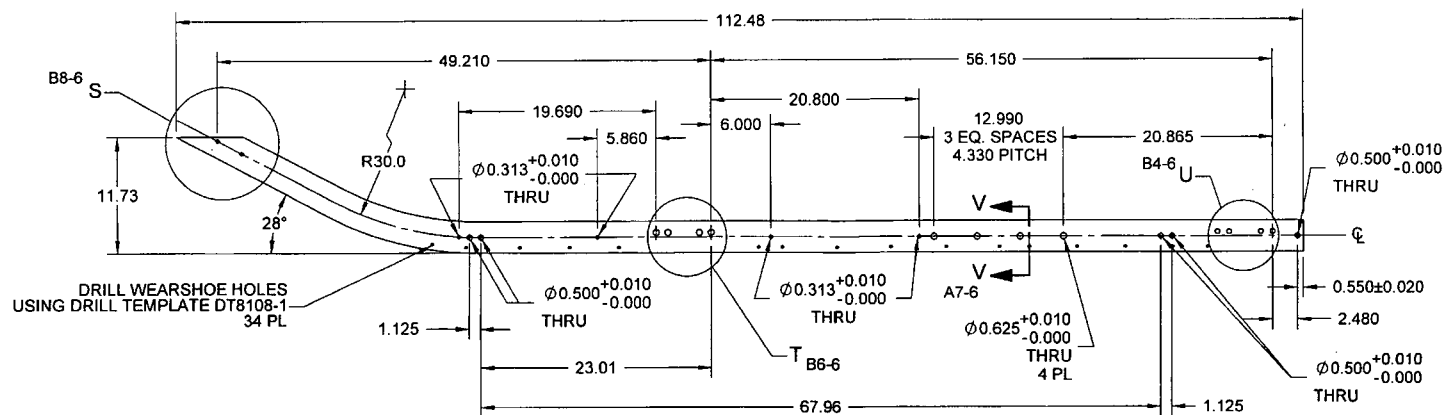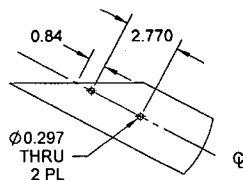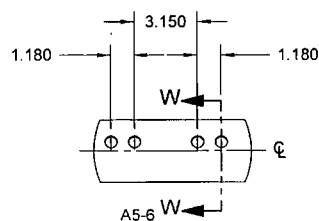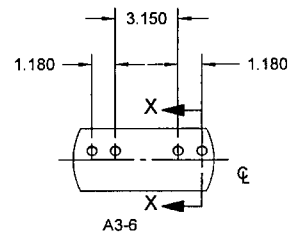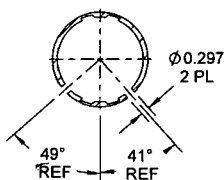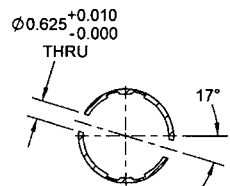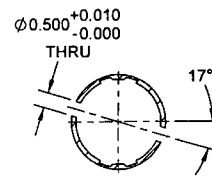**D2750-3 LH SKIDTUBE****DETAIL S**
D8-6
SCALE 2X**DETAIL T**
C5-6
SCALE 2X**DETAIL U**
D3-6
SCALE 2X**SECTION V-V**
C4-6
SCALE 3X, 17 PL**SECTION W-W**
B6-6
SCALE 3X, 4 PL**SECTION X-X**
B4-6
SCALE 3X, 4 PL**RELEASED**

DESIGN		DART AEROSPACE USA, INC.	
DRAWN		PORT HADLOCK, WA	
CHECKED		DRAWING NO. D2750	REV. F
MFG. APPR.			SHEET 6 OF 11
APPROVED		TITLE 350 SKIDTUBE ASSEMBLY	SCALE
DE APPR.			NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

NO. **2750-3**

WORK ORDER

WITHOUT NOTICE


SUBJECT TO AMENDMENT

INCONTROLLED COPY


ENGINEERING

RETURN TO


SHOP COPY

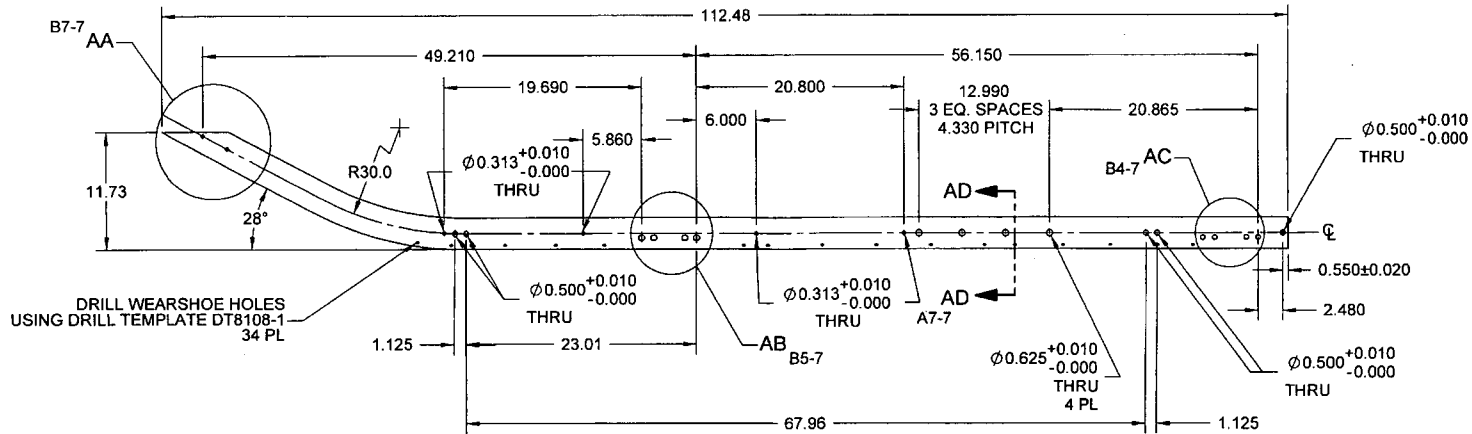


D2750-4 RH SKIDTUBE

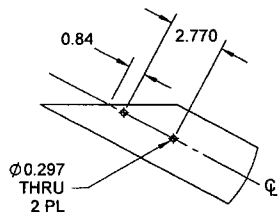


DETAIL AA
SCALE 2X

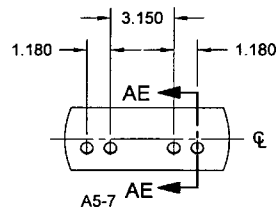


DETAIL AB
SCALE 2X

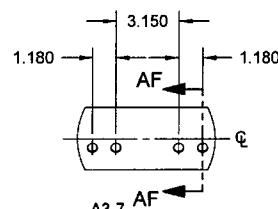


DETAIL AC
SCALE 2X

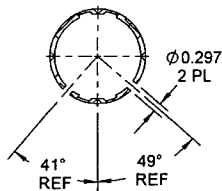

SECTION AD-AD
SCALE 3X, 17 PL

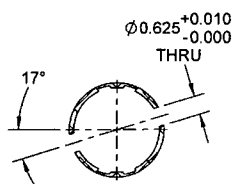

SECTION AE-AE
SCALE 3X, 4 PL

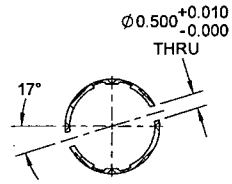


SECTION AF-AF
SCALE 3X, 4 PL






RELEASED
08-04-22

DESIGN		DART AEROSPACE USA, INC.	
DRAWN		PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2750	SHEET 7 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

NO. 1000
WORK ORDER
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
ENGINEERING
RETURN TO
COPY
STOP

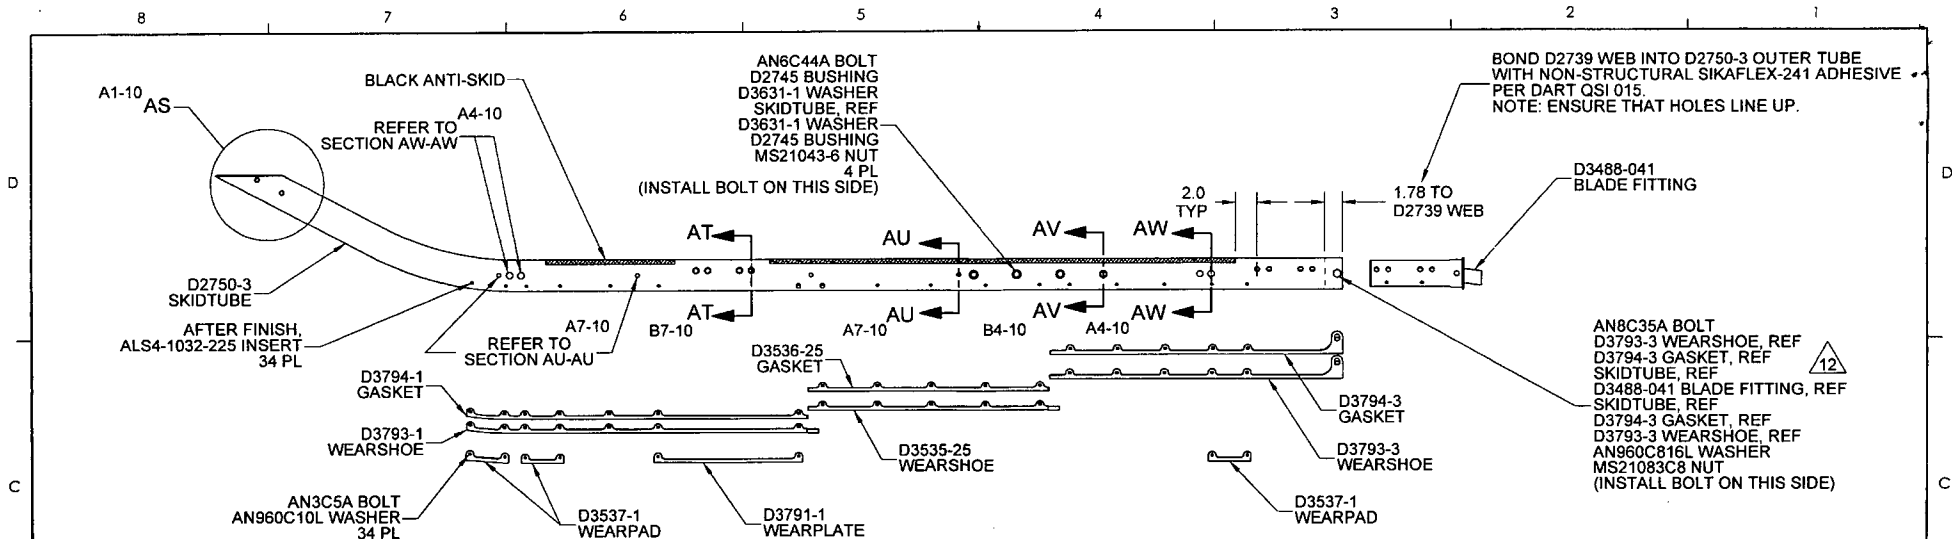

D2750-043 350 SKIDTUBE ASSEMBLY, LH

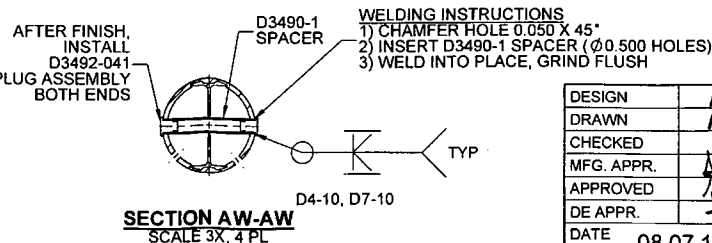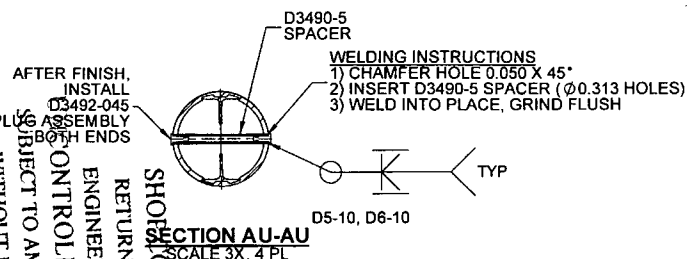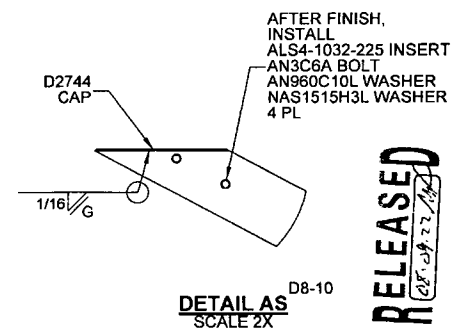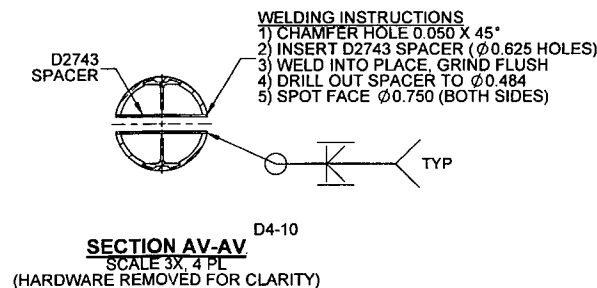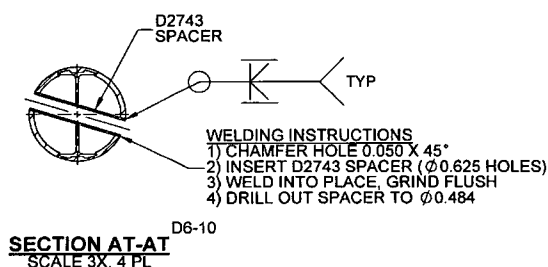


DESIGN		DART AEROSPACE USA, INC.
DRAWN		PORT HADLOCK, WA
CHECKED		DRAWING NO. D2750
MFG. APPR.		REV. F
APPROVED		SHEET 10 OF 11
DE APPR.		TITLE 350 SKIDTUBE ASSEMBLY
DATE	08.07.16	SCALE NTS

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.






NO. 47387
WORK ORDER
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
RETURN TO
ENGINEERING
SHOOT COPY

RELEASED
08.07.16

8 7 6 5 4 3 2 1

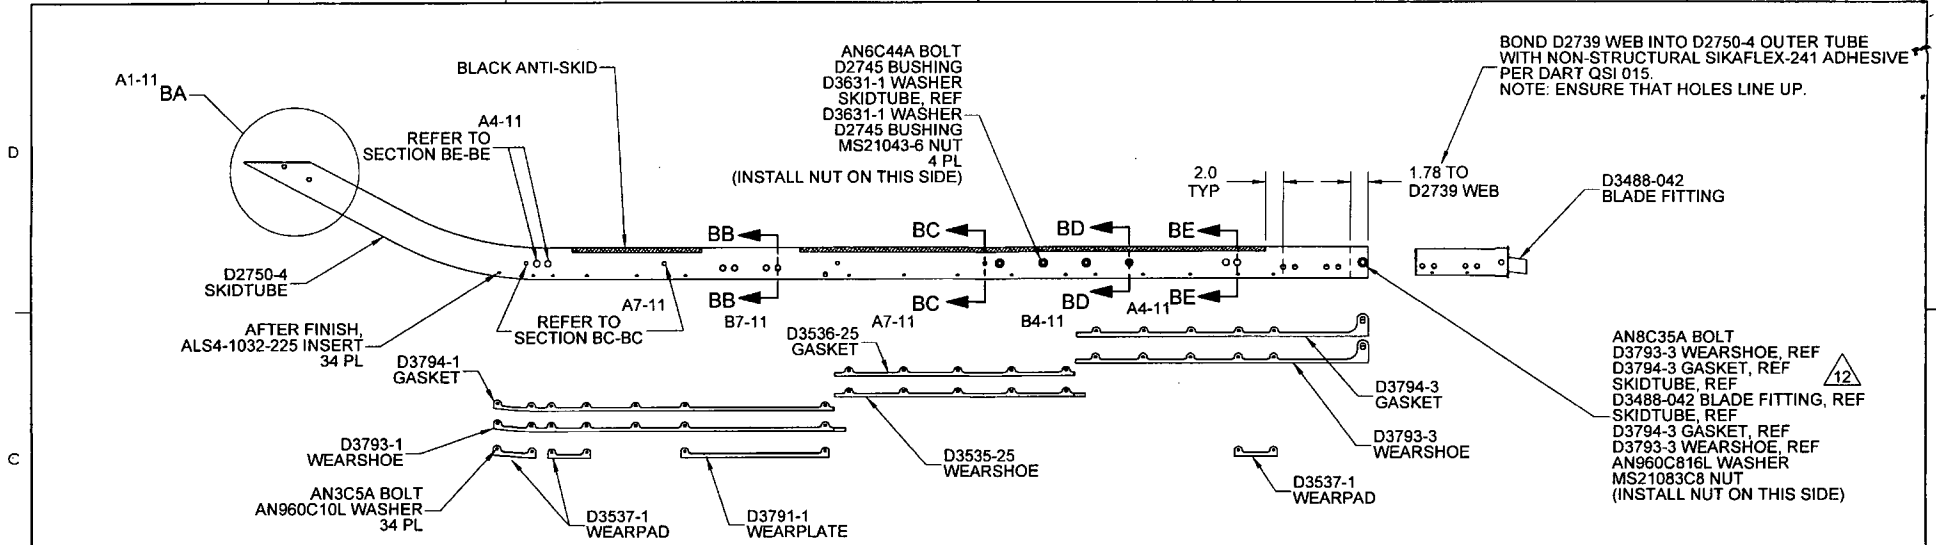

D2750-044 350 SKIDTUBE ASSEMBLY, RH

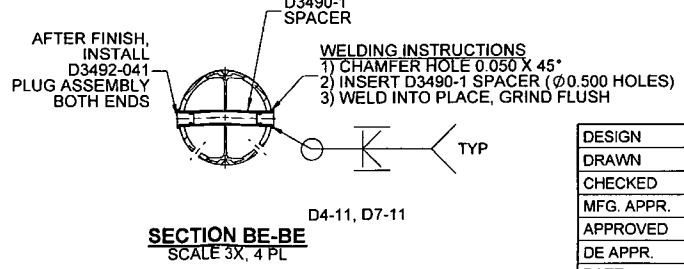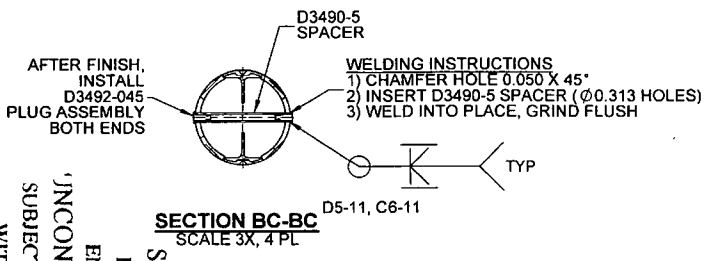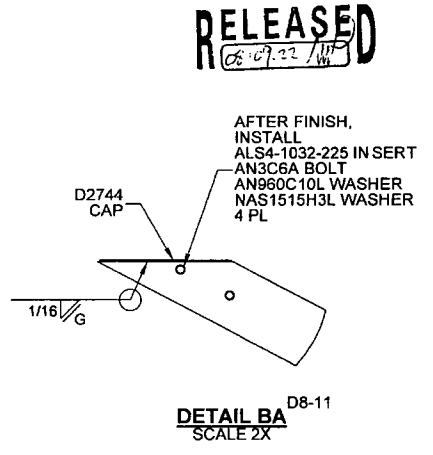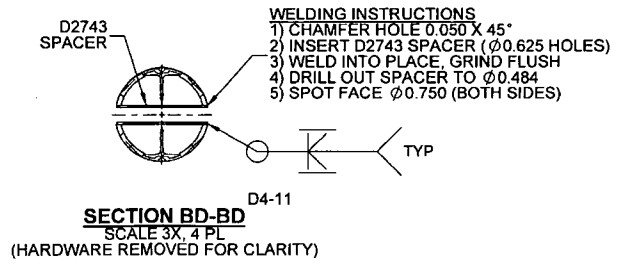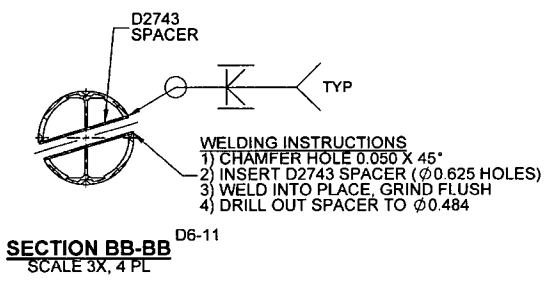


DESIGN	HA	DART AEROSPACE USA, INC.	
DRAWN	HA	PORT HADLOCK, WA	
CHECKED	HA	DRAWING NO.	REV. F
MFG. APPR.	HA	D2750	SHEET 11 OF 11
APPROVED	HA	TITLE	SCALE
DE APPR.	HA	350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

WORK ORDER NO. 123456
WITHOUT NOTICE
SUBJECT TO AMENDMENT
'UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

D3492-XX PLUG
(SEE TABLE)

NAS1611 PLUG
(SEE TABLE)

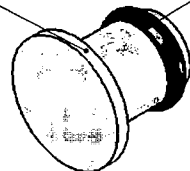

D3492-XXX PLUG PARTS LIST

QTY -041	QTY -043	QTY -045	QTY -047	QTY -049	QTY -051	QTY -053	PART NUMBER	DESCRIPTION
X							D3492-041	PLUG ASSEMBLY
	X						D3492-043	PLUG ASSEMBLY
		X					D3492-045	PLUG ASSEMBLY
			X				D3492-047	PLUG ASSEMBLY
				X			D3492-049	PLUG ASSEMBLY
					X		D3492-051	PLUG ASSEMBLY
						X	D3492-053	PLUG ASSEMBLY
1							D3492-1	PLUG
	1						D3492-3	PLUG
		1					D3492-5	PLUG
			1				D3492-7	PLUG
				1			D3492-9	PLUG
					1		D3492-11	PLUG
						1	D3492-13	PLUG
		1					NAS1611-005	O-RING
			1				NAS1611-007	O-RING
1							NAS1611-010	O-RING
						1	NAS1611-012	O-RING
	1						NAS1611-013	O-RING
					1		NAS1611-015	O-RING
				1			NAS1611-016	O-RING



NOTES:

1) O-RING: POSSIBLE SUPPLIER P/N: NAS1611-XXX OR PARKER 2-XXX

~~UNDER REVIEW~~

07.04.05

OK ASS 08.11.12

DEO ATTACHED



RELEASED

C	ADD -049/-051/-053, CHANGE DRAWING FORMAT	PH	07.10.05
B	ADD -047; UPDATE DIM A FOR -045	PH	06.05.11
A	NEW ISSUE	PH	06.01.04
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	07.10.05		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D3492	REV. C
TITLE PLUG	SHEET 1 OF 2
SCALE 2:1	
COPYRIGHT © 2007 BY DART AEROSPACE LTD. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 127387

8 7 6 5 4 3 2 1

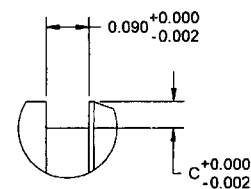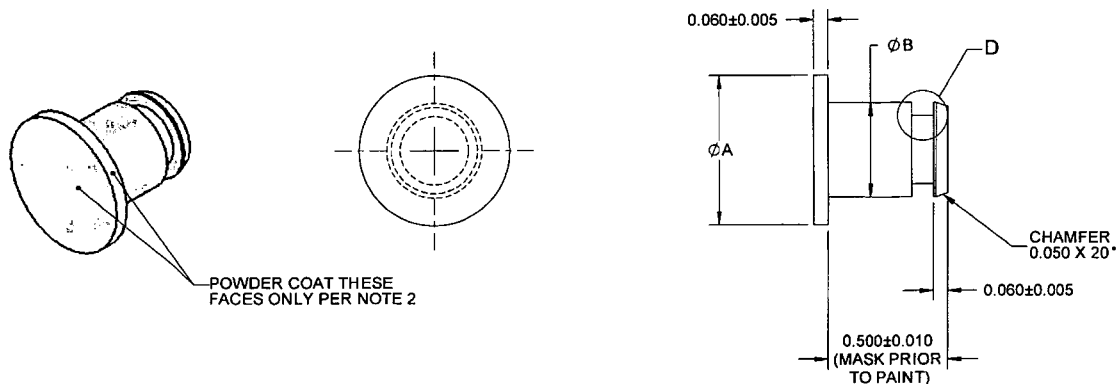

DETAIL D

D3492-XX PLUG

D3492-XX PLUG MACHINING DETAILS

P/N	A	B	C	MATERIAL SPEC
D3492-1	0.625	0.394	0.055	M6061T6R0.625
D3492-3	0.750	0.582	0.045	M6061T6R0.750
D3492-5	0.375	0.188	0.045	M6061T6R0.375
D3492-7	0.500	0.270	0.045	M6061T6R0.500
D3492-9	0.938	0.750	0.045	M6061T6R1.000
D3492-11	0.850	0.664	0.045	M6061T6R0.875
D3492-13	0.750	0.520	0.045	M6061T6R0.750

NOTES:

- 1) MATERIAL: ALUMINUM 5052-H32 OR 6061-T6 OR 1100-0 PER QQ-A-225/7 (5052) OR QQ-A-225/8 (6061) OR QQ-A-200/8 (6061) OR QQ-A-225/1 (1100) (REF. DART MATERIAL SPEC M6061T6R0.000)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE GLOSS (4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: N/A







UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 12389
SHOP COPY
RETURN TO
ENGINEERING

UNDER REVIEW

01.03.11
D3492-XX PLUG
REV. 01 (HAWKESBURY)
11.08.11.12
OK

DEO ATTACHED

RELEASED
07.11.16

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. C
MFG. APPR.		D3492	SHEET 2 OF 2
APPROVED		TITLE	SCALE
DE APPR.		PLUG	4:
DATE	07.10.05	COPYRIGHT © 2007 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD			

8 7 6 5 4 3 2 1

DRAWING NO. D3492	TITLE PLUG	REV. C	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D3492-C-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN AJS	CHECKED	MFG. APPR.	APPROVED		DE APPR.		
DATE 08.11.05	DATE 08.11.05	DATE 08.11.05	DATE 08/11/05		DATE 08/11/05		

SHEET 2 MODIFY -13 PLUG AS SHOWN:

IS:

D3492-XX PLUG MACHINING DETAILS

P/N	A	B	C	MATERIAL SPEC
D3492-13	0.750	0.510	0.045	M6061T6R0.750

WAS:

D3492-XX PLUG MACHINING DETAILS

P/N	A	B	C	MATERIAL SPEC
D3492-13	0.750	0.520	0.045	M6061T6R0.750

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 213917

RELEASED
08/11/10

NO. 197

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barday Elliott
Job number: 47399
Part number: D350 636 012
Description: 300 skid tube
Welding Process: Tig[☒] Mig[]
Base material: Aluminium
Current: AC[] DC[]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[]
Penetration: pass[☒] fail[]

UNACCEPTABLE

Cracks: pass[☒] fail[]
Undercut: pass[☒] fail[]
Pin holes: pass[☒] fail[]
Overlap (cold lap): pass[☒] fail[]
Porosity (surface): pass[☒] fail[]
Coloration: pass[☒] fail[]

Qualifier P. J. D. Smith Date of Test Coupon 09-04-27
Welder Barday Elliott Date of Test Coupon 09-04-27

The above named individual is qualified in accordance with AWS D17.1.2001 to weld